




Suitability and starting values for cutting speed (vc), feed (f) and depth of cut (ap). Refer to our Machining Calculator app for further calculations.

Product		RE [mm]	P			M			K			N			S			H		
			vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap
			[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]




W-NM wiper geometry for finish to rough machining with increased feed rates and improved surface finish.

WNMG 080404W-NM	T7325	0.4	195	0.20	2.1	150	0.18	2.1	—	—	—	—	—	—	60	0.16	1.7	—	—	—
	T7335	0.4	190	0.20	2.1	145	0.18	2.1	—	—	—	—	—	—	60	0.16	1.7	—	—	—
	T9315	0.4	270	0.20	2.1	—	—	—	255	0.20	2.1	—	—	—	—	—	—	—	—	—
	T9325	0.4	240	0.20	2.1	140	0.18	2.1	225	0.20	2.1	—	—	—	50	0.16	1.7	—	—	—
WNMG 080408W-NM	T7325	0.8	215	0.25	2.1	165	0.23	2.1	—	—	—	—	—	—	65	0.20	1.7	—	—	—
	T7335	0.8	210	0.25	2.1	160	0.23	2.1	—	—	—	—	—	—	65	0.20	1.7	—	—	—
	T9315	0.8	290	0.25	2.1	—	—	—	275	0.25	2.1	—	—	—	—	—	—	—	—	—
	T9325	0.8	260	0.25	2.1	155	0.23	2.1	245	0.25	2.1	—	—	—	55	0.20	1.7	—	—	—
WNMG 080412W-NM	T7325	1.2	215	0.30	2.1	165	0.27	2.1	—	—	—	—	—	—	65	0.24	1.7	—	—	—
	T7335	1.2	210	0.30	2.1	160	0.27	2.1	—	—	—	—	—	—	65	0.24	1.7	—	—	—
	T9315	1.2	285	0.30	2.1	—	—	—	270	0.30	2.1	—	—	—	—	—	—	—	—	—

WNMM




	IC [mm]	D1 [mm]	L [mm]	S [mm]
0804	12.700	5.16	8.70	4.76
1006	15.875	6.35	10.80	6.35
1306	19.050	7.94	13.00	6.35

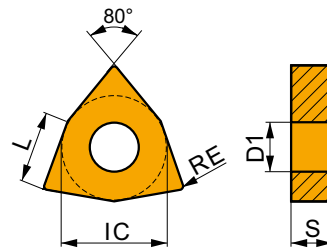


Suitability and starting values for cutting speed (vc), feed (f) and depth of cut (ap). Refer to our Machining Calculator app for further calculations.

Product		RE [mm]	P			M			K			N			S			H		
			vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap
			[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]




DR geometry for semi-rough to rough machining, and continuous to interrupted cuts.

WNMM 100608E-DR	T9325	0.8	205	0.40	5.0	120	0.36	5.0	190	0.40	5.0	—	—	—	—	—	—	—	—	—
	T9335	0.8	175	0.40	5.0	105	0.36	5.0	—	—	—	—	—	—	—	—	—	—	—	—
WNMM 130612E-DR	T9325	1.2	200	0.45	6.0	120	0.41	6.0	190	0.45	6.0	—	—	—	—	—	—	—	—	—
	T9335	1.2	170	0.45	6.0	100	0.41	6.0	—	—	—	—	—	—	—	—	—	—	—	—



NR geometry for semi-rough to rough machining, and continuous to interrupted cuts.

WNMM 080408E-NR	T7325	0.8	175	0.40	3.0	135	0.36	3.0	—	—	—	—	—	—	55	0.28	2.4	—	—	—
	T8330	0.8	155	0.40	3.0	90	0.36	3.0	145	0.40	3.0	—	—	—	35	0.28	2.4	—	—	—
	T8430	0.8	165	0.40	3.0	90	0.36	3.0	135	0.40	3.0	—	—	—	35	0.28	2.4	—	—	—
	T9325	0.8	195	0.40	3.0	115	0.36	3.0	185	0.40	3.0	—	—	—	40	0.28	2.4	—	—	—





NR2 geometry for semi-rough to rough machining, and continuous to interrupted cuts.

WNMM 080408E-NR2	T7335	0.8	160	0.40	4.0	120	0.36	4.0	—	—	—	—	—	—	50	0.28	3.2	—	—	—
	T9325	0.8	190	0.40	4.0	110	0.36	4.0	180	0.40	4.0	—	—	—	40	0.28	3.2	—	—	—




Suitability and starting values for cutting speed (vc), feed (f) and depth of cut (ap). Refer to our Machining Calculator app for further calculations.

Product		RE [mm]	P			M			K			N			S			H		
			vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap
			[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]

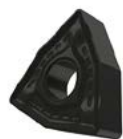

NR2 geometry for semi-rough to rough machining, and continuous to interrupted cuts.

WNMM 080412E-NR2	T7325	1.2	175	0.45	4.0	135	0.41	4.0	—	—	—	—	—	—	55	0.32	3.2	—	—	—
	T9325	1.2	190	0.45	4.0	110	0.41	4.0	180	0.45	4.0	—	—	—	40	0.32	3.2	—	—	—




OR geometry for semi-rough to rough machining, and continuous to interrupted cuts.

WNMM 080408E-OR	T8330	0.8	150	0.40	4.0	90	0.36	4.0	140	0.40	4.0	—	—	—	35	0.28	3.2	—	—	—
	T8430	0.8	155	0.40	4.0	85	0.36	4.0	130	0.40	4.0	—	—	—	30	0.28	3.2	—	—	—
	T9325	0.8	190	0.40	4.0	110	0.36	4.0	180	0.40	4.0	—	—	—	40	0.28	3.2	—	—	—
	T9335	0.8	165	0.40	4.0	95	0.36	4.0	—	—	—	—	—	—	35	0.28	3.2	—	—	—
WNMM 080412E-OR	T9325	1.2	190	0.45	4.0	110	0.41	4.0	180	0.45	4.0	—	—	—	40	0.36	3.2	—	—	—
	T9335	1.2	170	0.45	4.0	100	0.41	4.0	—	—	—	—	—	—	35	0.36	3.2	—	—	—
WNMM 080416E-OR	T9325	1.6	195	0.50	4.0	115	0.45	4.0	185	0.50	4.0	—	—	—	40	0.40	3.2	—	—	—
WNMM 130612E-OR	T9325	1.2	185	0.45	6.0	110	0.41	6.0	175	0.45	6.0	—	—	—	40	0.36	4.8	—	—	—
WNMM 130616E-OR	T9325	1.6	180	0.50	6.0	105	0.45	6.0	170	0.50	6.0	—	—	—	40	0.40	4.8	—	—	—

WNGA CBN




	IC	D1	L	S
	[mm]	[mm]	[mm]	[mm]
0804	12.700	5.16	8.70	4.76

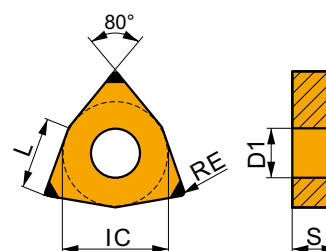


Suitability and starting values for cutting speed (vc), feed (f) and depth of cut (ap). Refer to our Machining Calculator app for further calculations.

Product		RE [mm]	P			M			K			N			S			H		
			vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap	vc	f	ap
			[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]	[m/min]	[mm/rev]	[mm]



For finish machining and continuous cuts.

WNGA 080408S01020C	TB310	0.8	—	—	—	—	—	—	530	0.15	0.6	—	—	—	140	0.11	0.5	110	0.15	1.0
--------------------	-------	-----	---	---	---	---	---	---	-----	------	-----	---	---	---	-----	------	-----	-----	------	-----



For finish machining and continuous cuts.

WNGA080408S01020WC	TB310	0.8	—	—	—	—	—	—	530	0.15	0.6	—	—	—	140	0.11	0.5	110	0.15	1.0
--------------------	-------	-----	---	---	---	---	---	---	-----	------	-----	---	---	---	-----	------	-----	-----	------	-----